


SIRUBA®









銀箭牌工業用縫紉機
INDUSTRIAL SEWING MACHINE

Z008


零件圖 PARTS LIST


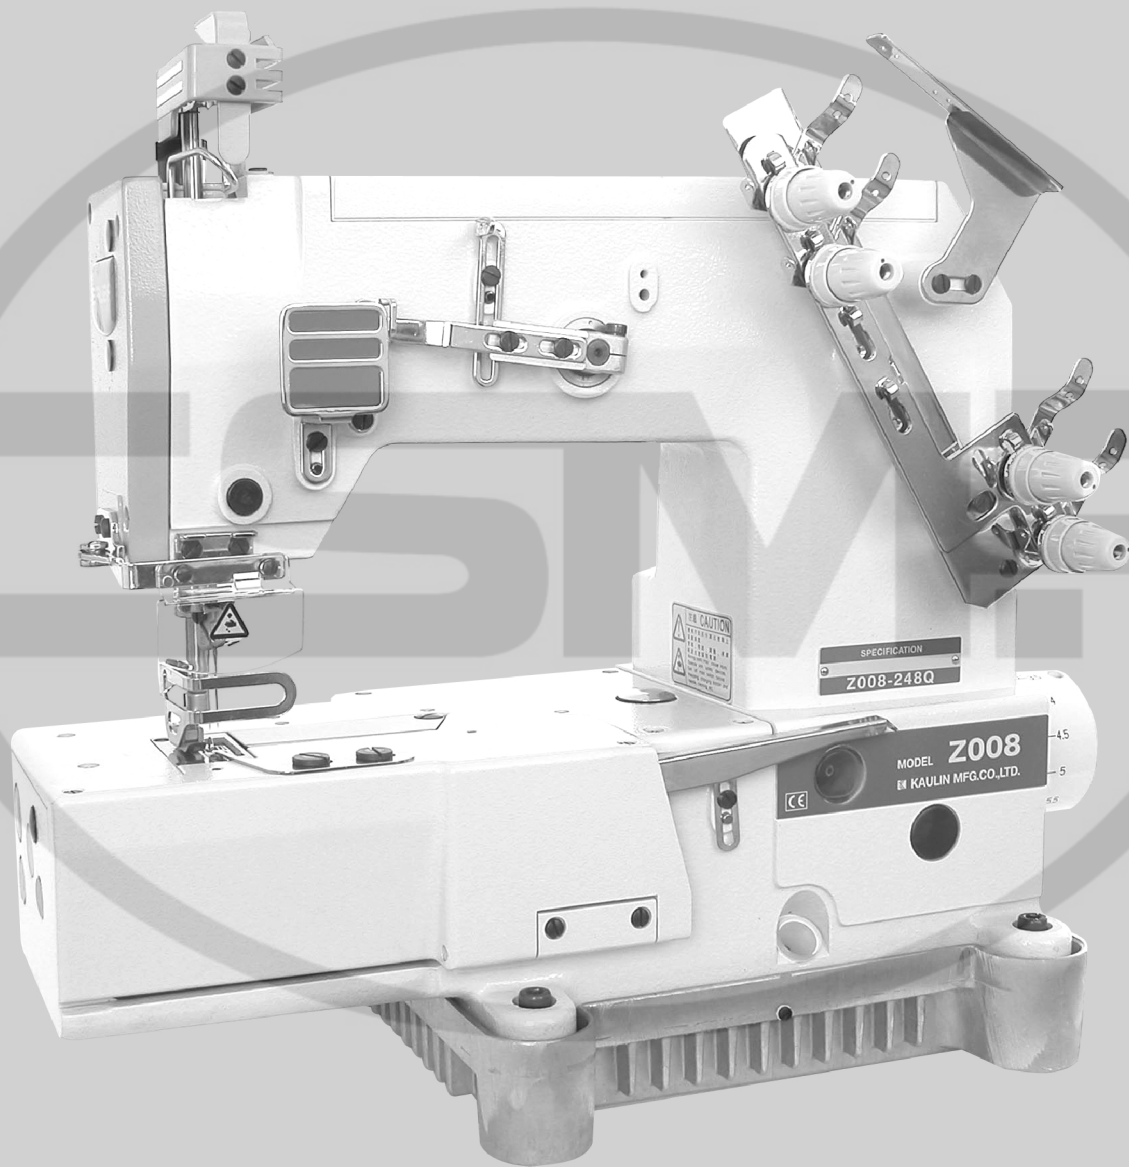


高林股份有限公司
KAULIN MFG. CO., LTD.

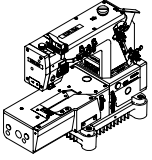								
機 型 MODEL	針 鉗 NEEDLE CLAMP	針 板 NEEDLE PLATE	針 舌 REAR NAIL	主送具 REAR FEED DOG	差動送具 FRONT FEED DOG	押 具 PRESSER FOOT	勾針組 LOOPER	針 號 NEEDLE
Z008-148P	M7873	E7873	E7873-1 E7873-2	D7873	H7873	P7872-A	ZD21-A	U0163#11*1
Z008-148Z	M7873	E7871	無	D7871	H7871	P7871-A	ZD21-A	U0163#11*1
Z008-248Q	M7873	E7873	E7873-1 E7873-2 E7873-3	D7873	H7873	P7872-A	ZD21-A ZD22-A	U0163#11*2
Z008-248W	M7873	E7873	E7873-1 E7873-2 E7873-3	D7873	H7873	P7873-A	ZD21-A ZD22-A	U0163#11*2
Z008-248X	M7873	E7873	E7873-1 E7873-2 E7873-3	D7873	H7873	P7873-A	ZD21-A ZD22-A	U0163#11*2
Z008-248Y	M7873	E7873	E7873-1 E7873-2 E7873-3	D7873	H7873	P7873B-A	ZD21-A ZD22-A	U0163#11*2

PARTS LIST FOR ZB GROUP

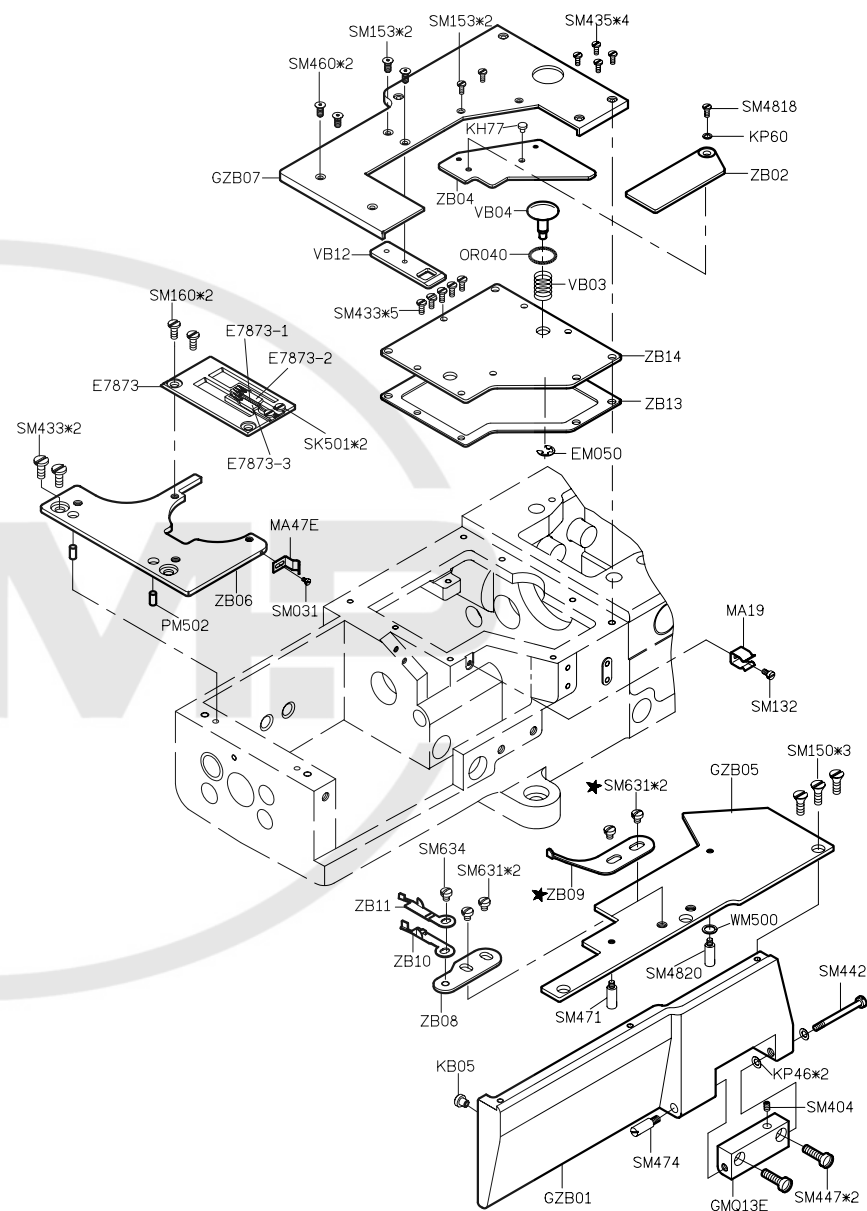

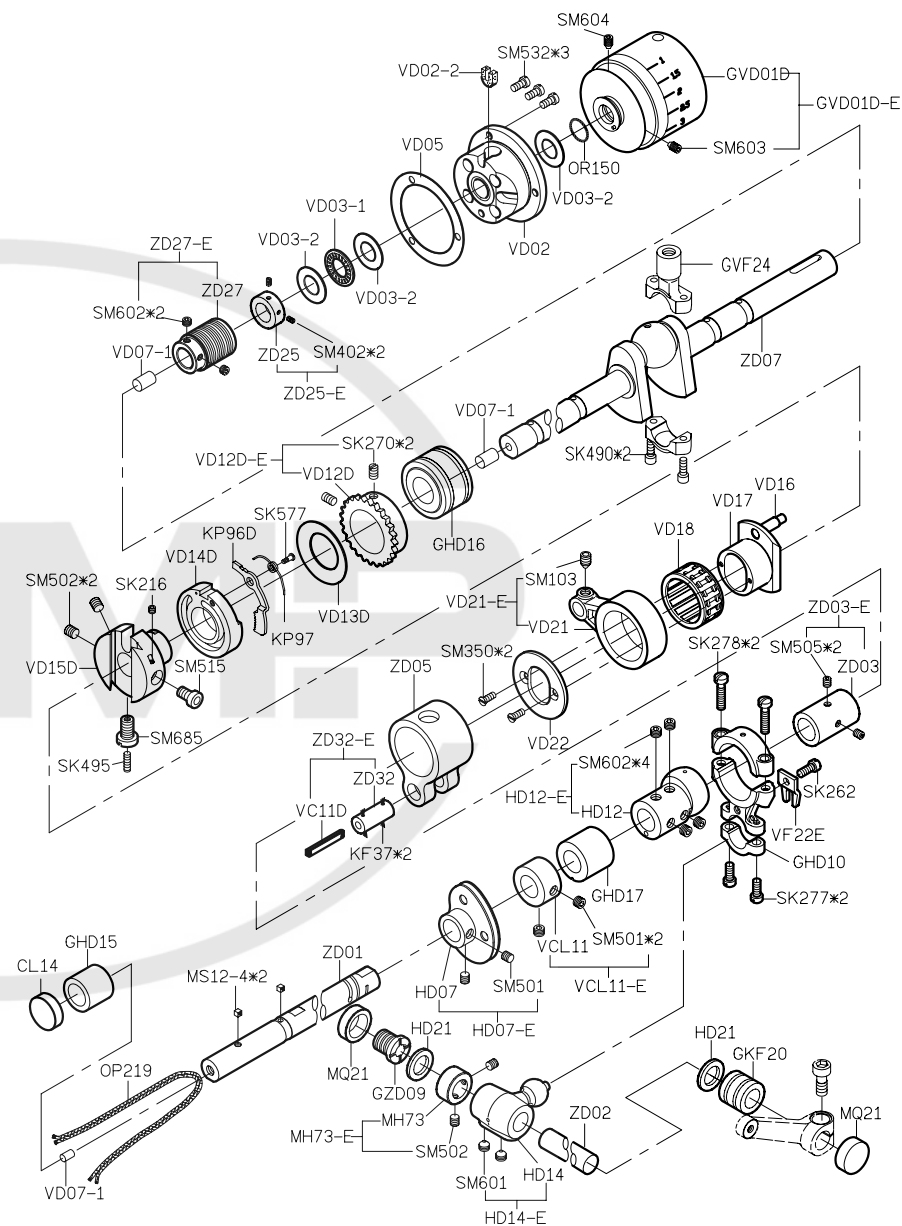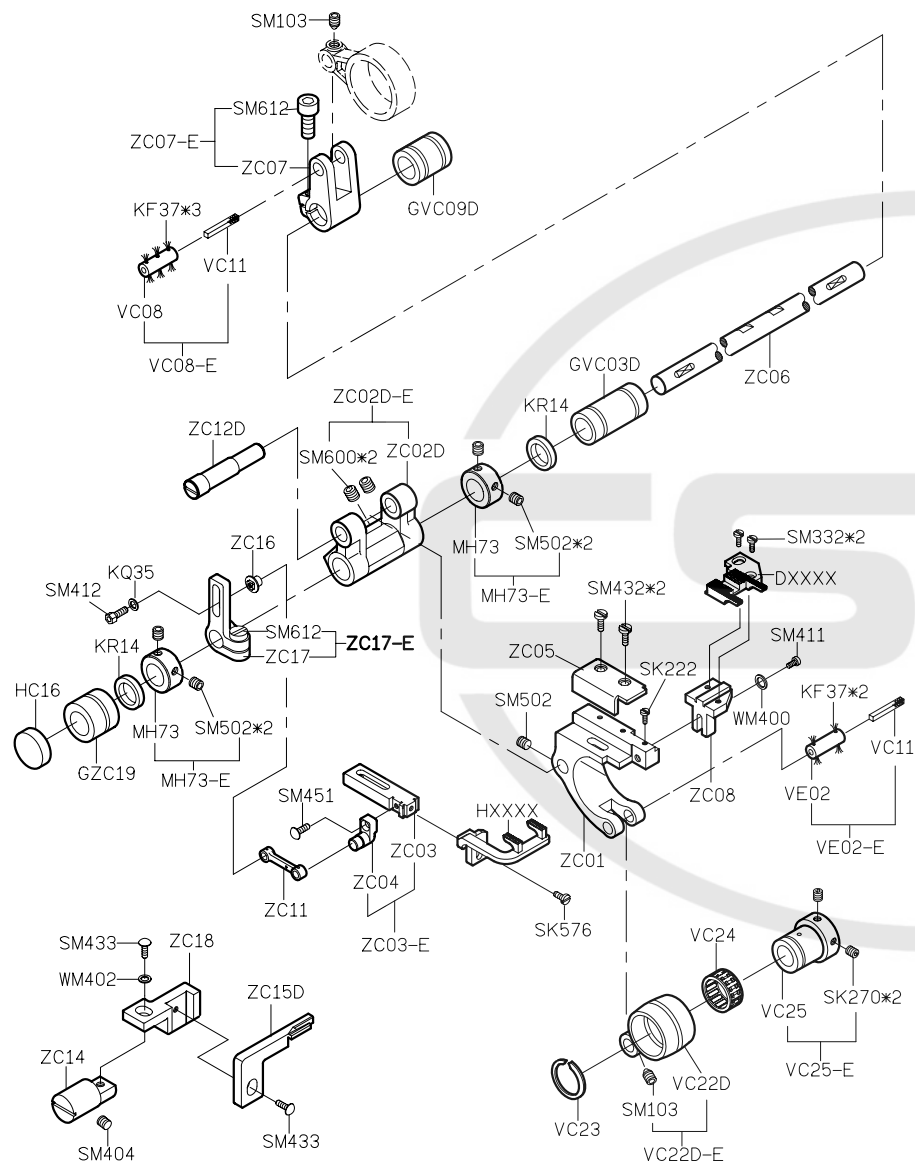

This diagram illustrates the exploded view of a mechanical assembly, showing the relationship between various components. The parts are labeled as follows:


- Top Section:** ZD16-E, ZD16, SM610, GHE23, SM184, ZD15, SM421, VC11, KF37*2.
- Left Section:** NM611, SW06, GVE03D, GHE20, KF07, SK270*2, ZD17, SM612, ZD17-E, ZD28, KF07-E.
- Center Section:** WM600, CL31, ZD31, HE27, ZD31-A, ZD04, ZD22, ZD22-1, ZD22-2, SK207, NM611, SM139*2, ZD21, ZD21-1, ZD18D, ZD14, ZD19D, WM80B, SK270*2, ZD20D, ZD20D-E.
- Right Section:** ZD26-E, ZD26, SM502*2, NM610, SK490*2, GZD08, ZD23D-A, ZD23D-E, ZD23D, SM139*4, ZD31, OR070, SM617, ZD13, NM611, SK867*2, ZD31, SM134.

The diagram uses dashed lines to indicate the assembly path and alignment of the components.


This diagram illustrates the exploded view of a mechanical assembly, showing the relationship between various components. The parts are labeled with alphanumeric codes:

- Top Left Components:** NM511, CL48, CL49, SK257, ZE14, KN13, SM104, CL48, SM413, ALT087S, ZE11, CL47, OP213, OP343, OT612, KT26, KT24, ZE06.
- Top Right Components:** ZE12, ZE26, ZE25, KF37, ZE08-E, ZE08, SM502*2, ZE18, ZE20, ZE28, ZE28-E, SM502*2, KN13, ZE23.
- Bottom Left Components:** ZE01, ZE05, ZE02, KF37*2, SK809, GZE01-1, SM103, SM102, SM402, OP215, GZE04, SK270*2, KV14, KV14-E, ZE16, ZE15, ZE17, NM511, VF10-E, VF10, VC11, KF37*2, ZE10.
- Bottom Right Components:** ZE09-E, ZE09, SM604, SM602, ZD26, GZE19.



The diagram uses dashed lines to indicate the assembly sequence and alignment of the parts. A large, faint watermark "M" is visible in the background.

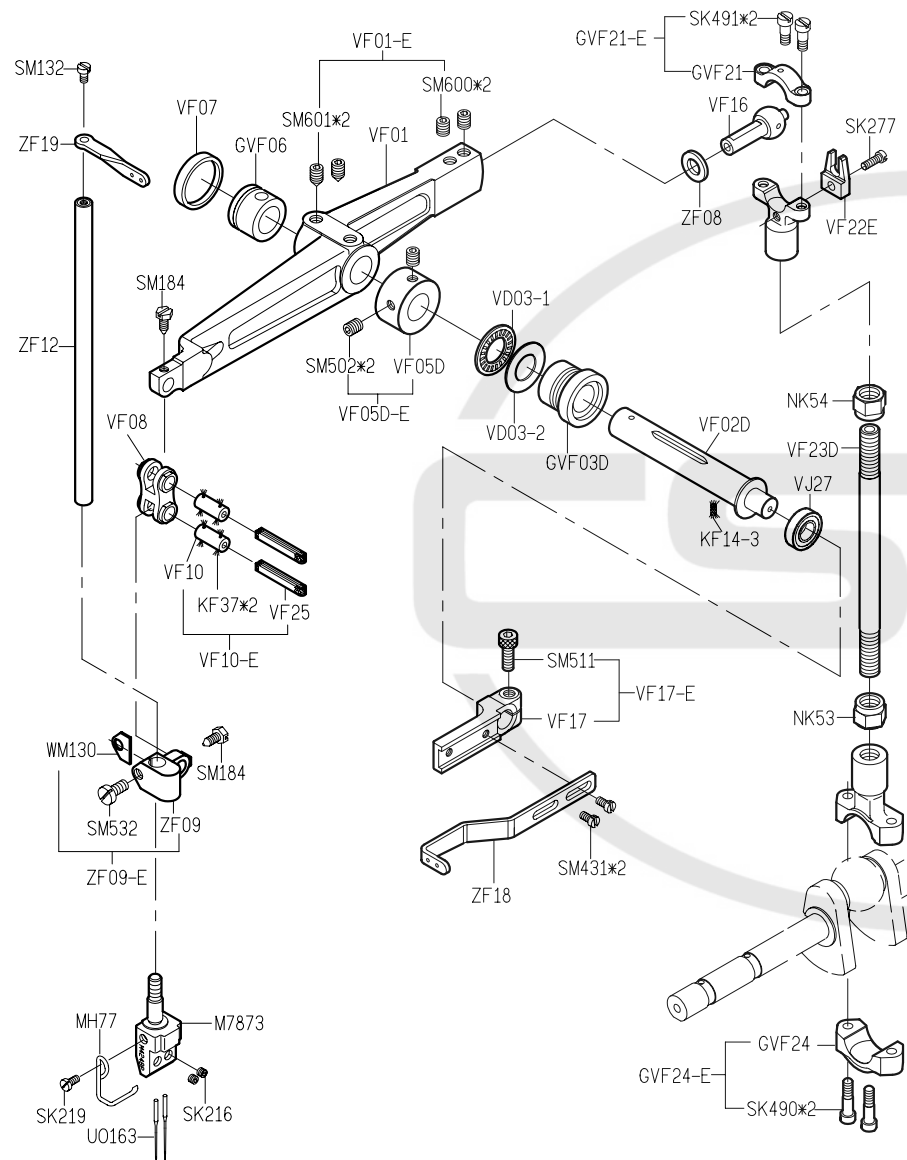

PARTS LIST FOR ZF GROUP


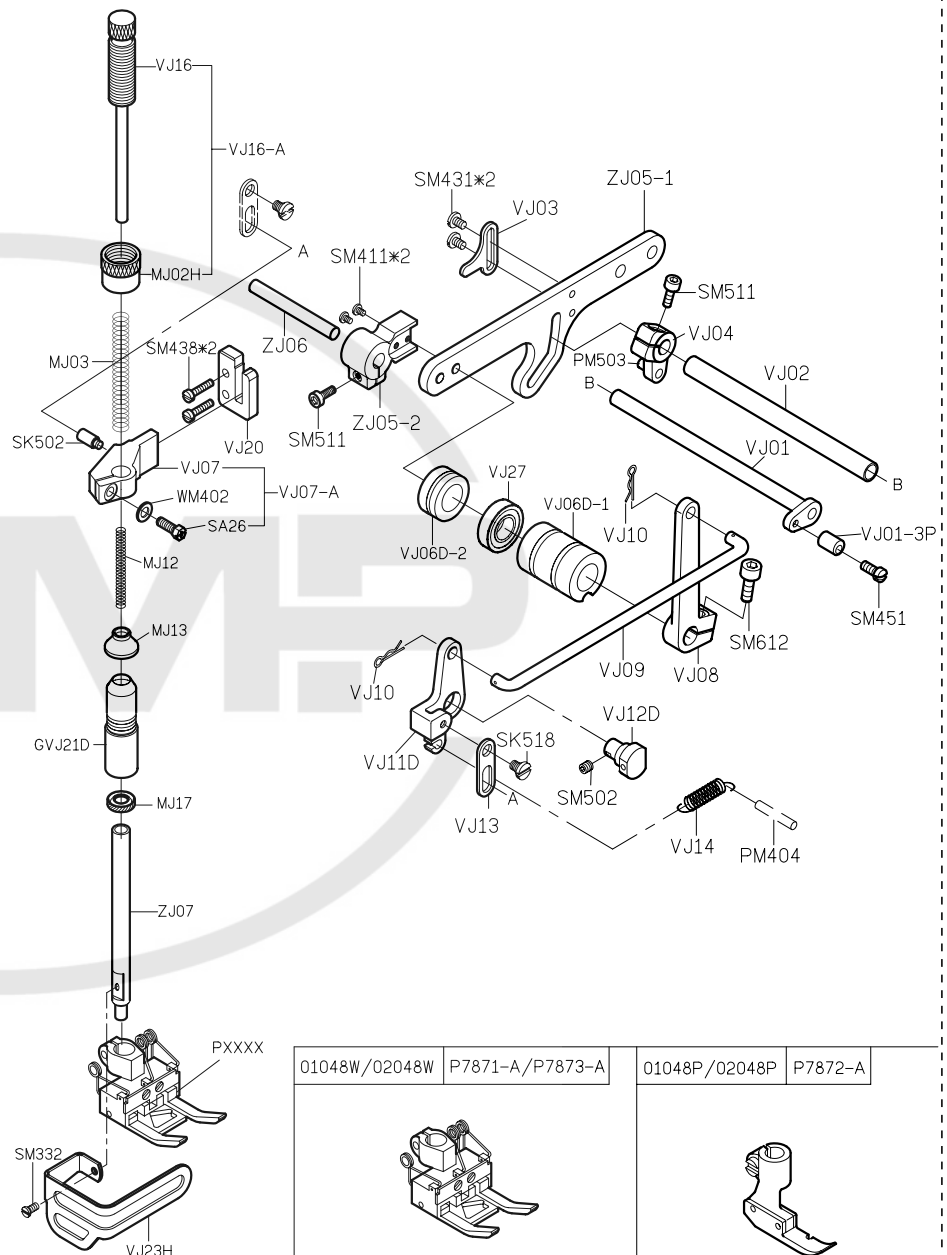


PARTS LIST FOR ZJ GROUP

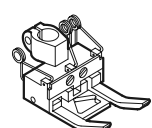01048W/02048W	P7871-A/P7873-A	01048P/02048P	P7872-A
			




PARTS LIST FOR ZK (1) GROUP


PARTS LIST FOR ZK (2) GROUP

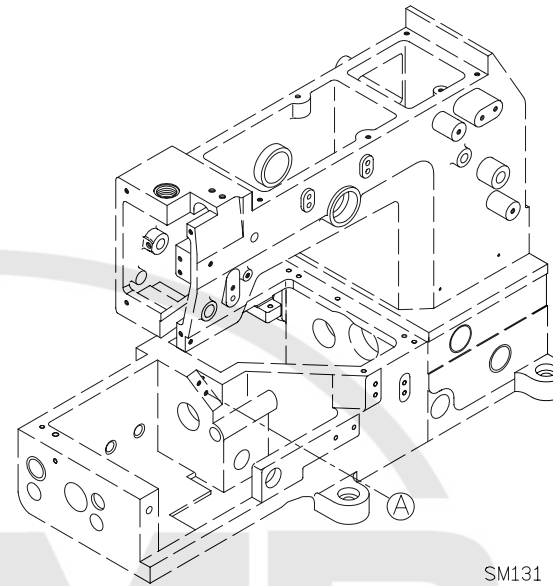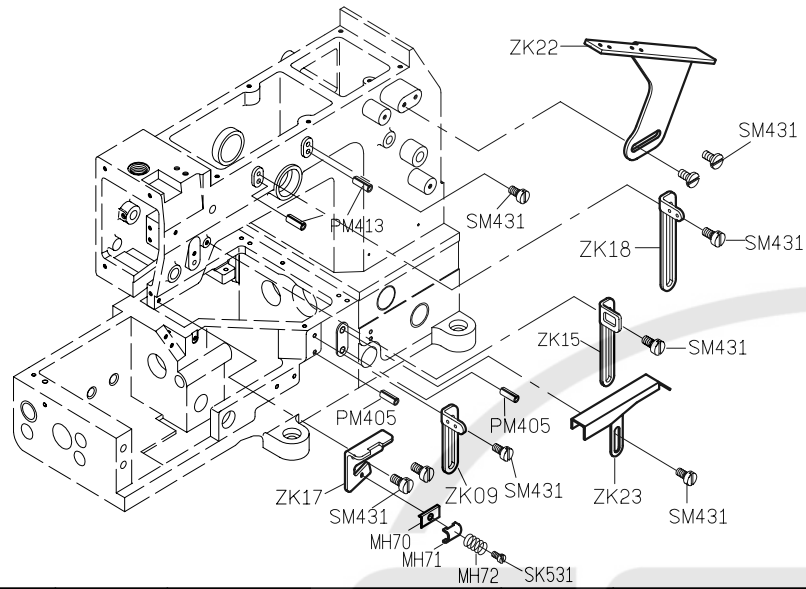


1-NEEDLE ZK01-A

2-NEEDLE ZK04-A

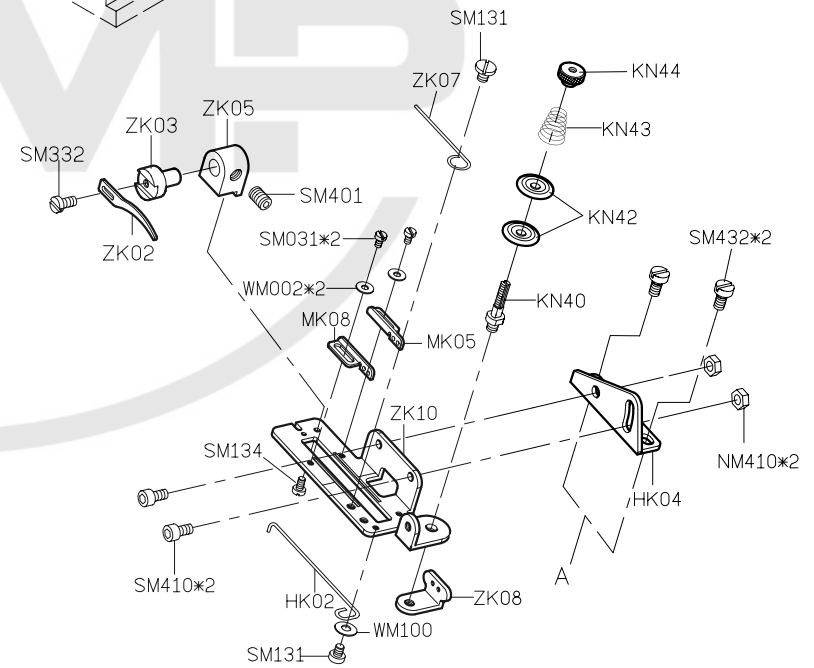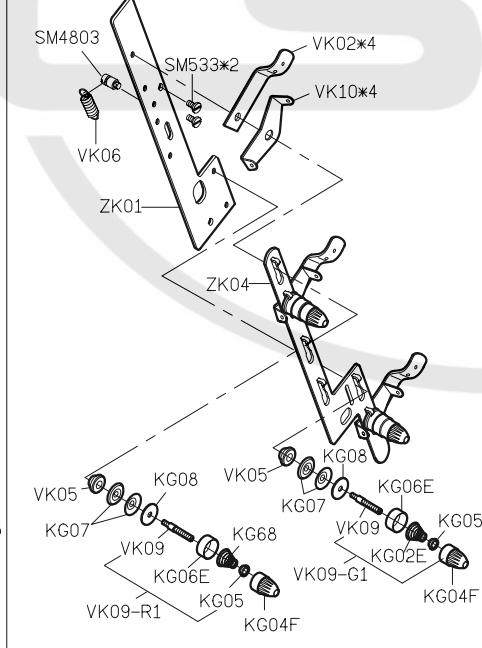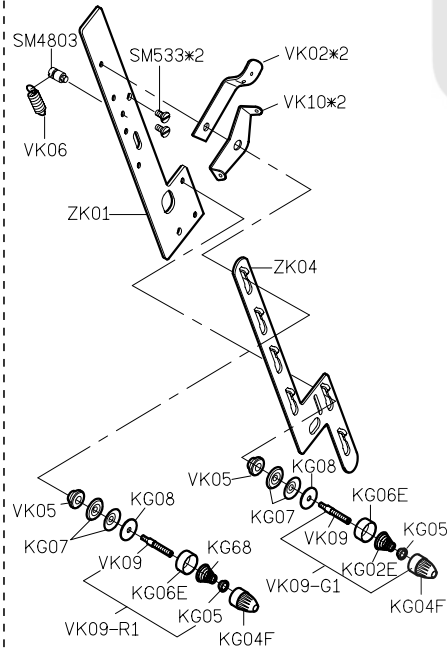

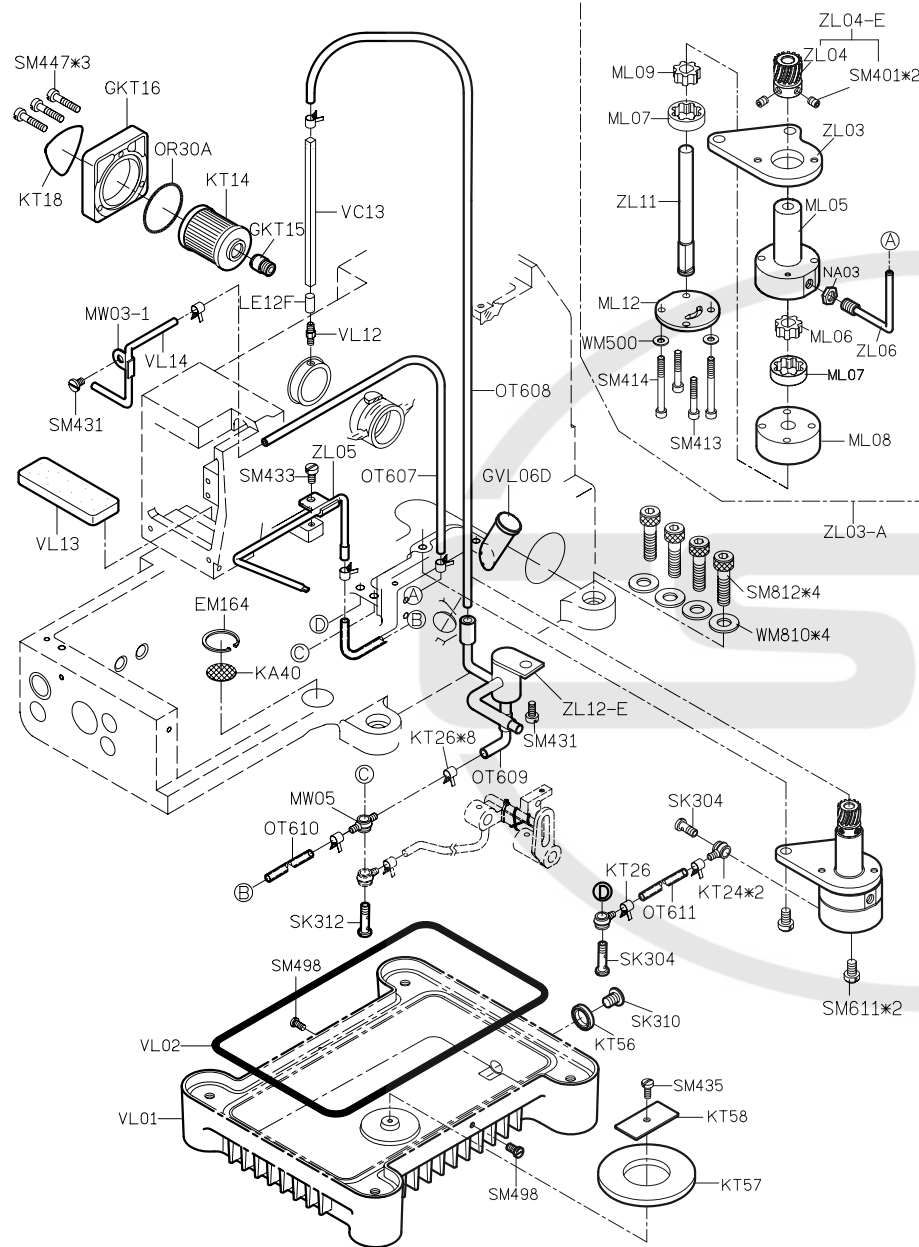

PARTS LIST FOR ZL GROUP

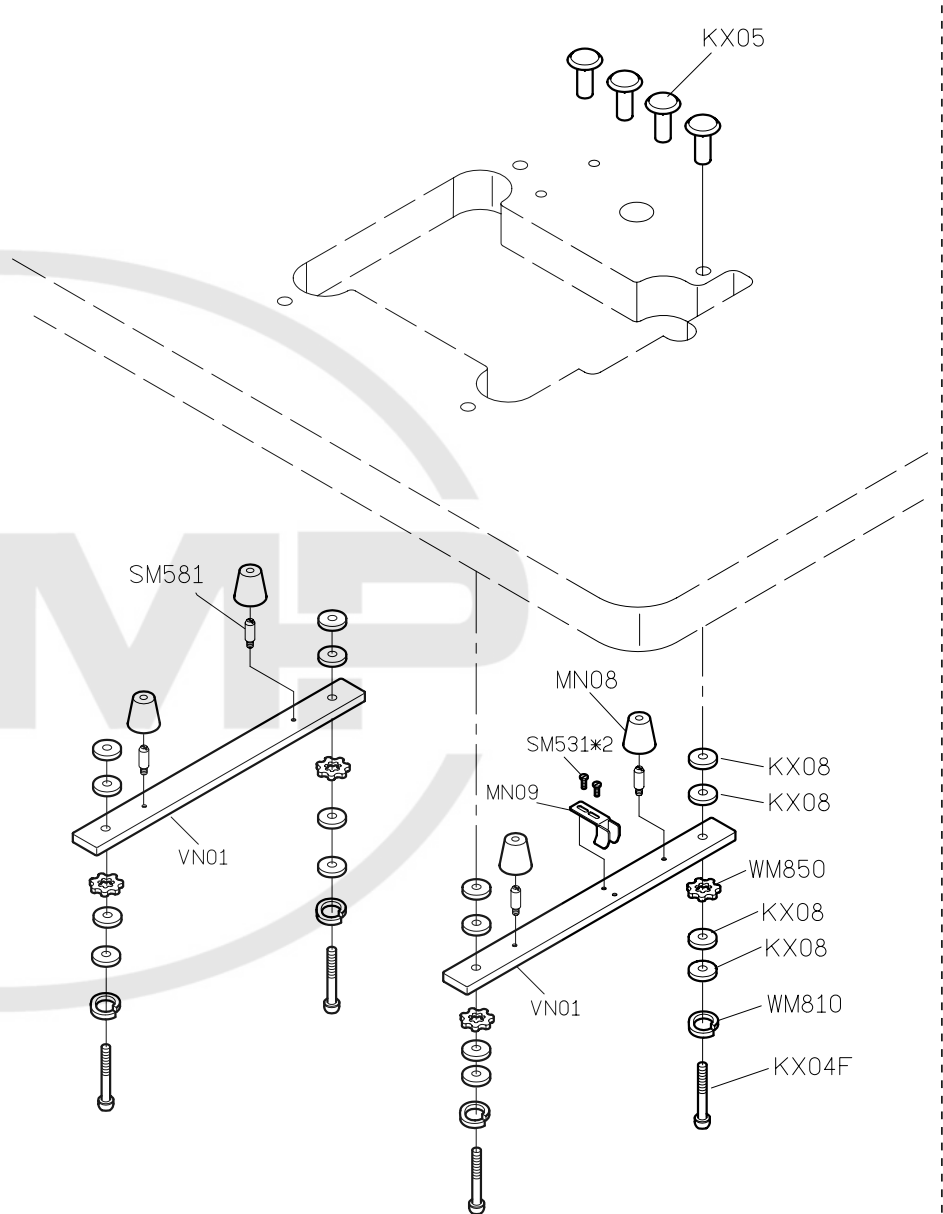



PARTS LIST FOR ZN (1) GROUP

PARTS LIST FOR ZN (2) GROUP


PARTS LIST FOR THREAD STAND (1) GROUP

8

FOR 1-NEEDLE KW40E-3

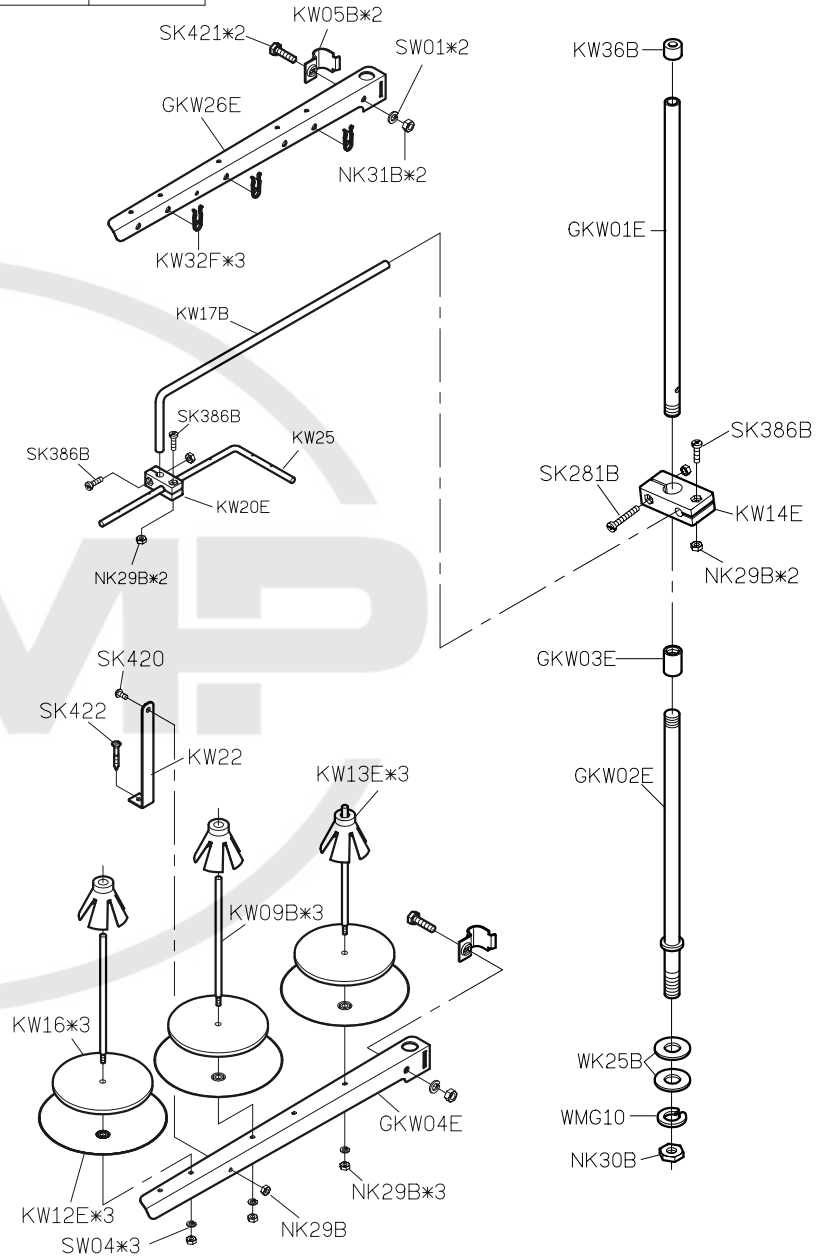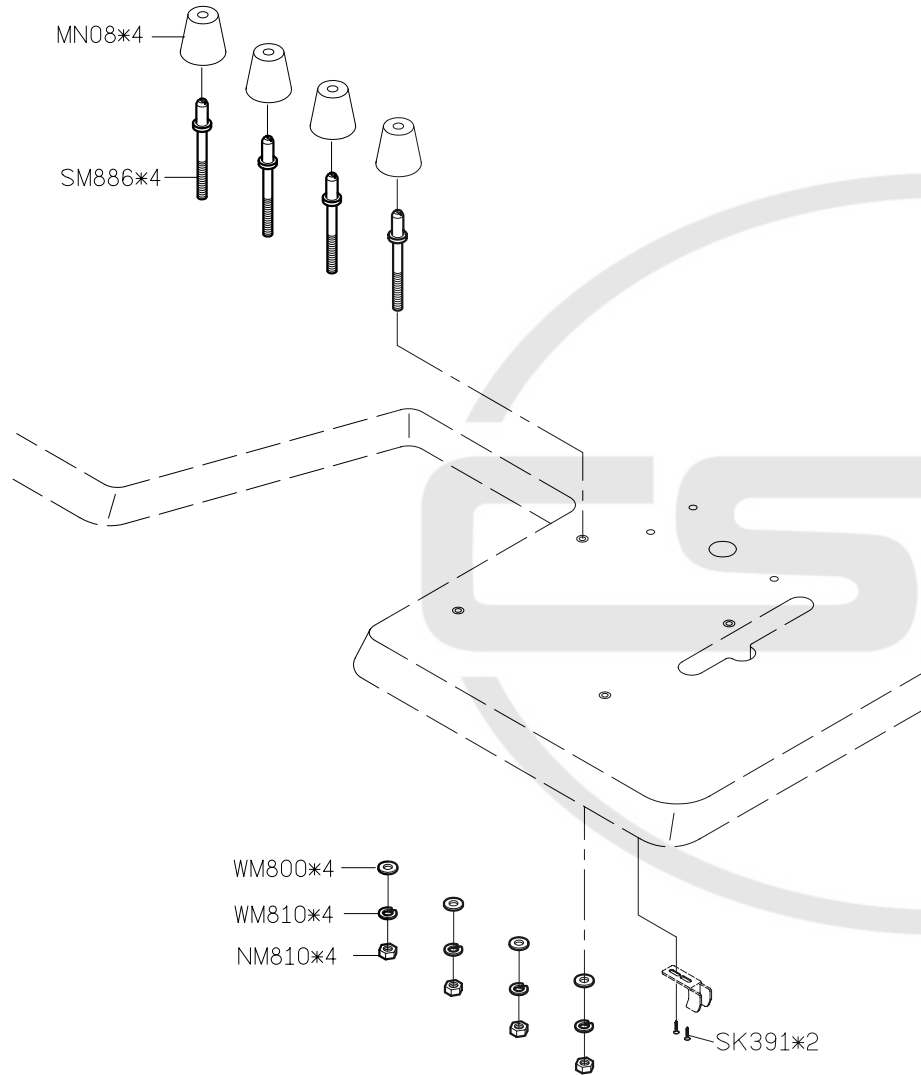


FOR 2-NEEDLE KW40E-6

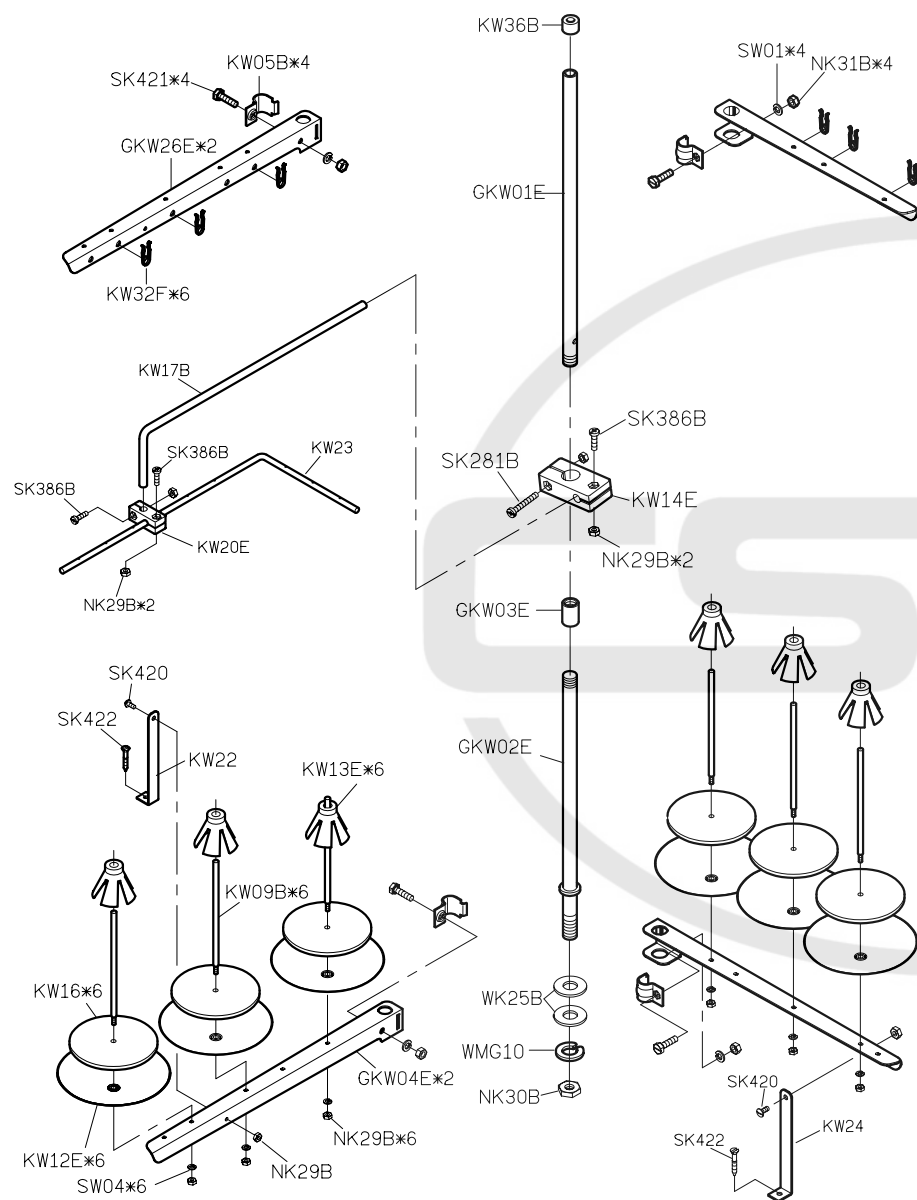


PARTS LIST FOR THREAD STAND (2) GROUP

GMV01
防塵罩



KY02-A
油 罐



KY03
油 壺



KY04
漏 斗



KZ03
乾燥劑



KY07
開口板手



KY08
開口板手



KY09
開口板手



MY09
六角板手



MY08
六角板手



MY10
六角板手




MY11
六角板手




MY12
六角板手



KY11
六角板手



KY14
內六角螺絲起子



KY16
一字起子




KY17
一字起子



KY18
鑷 子




KT14
濾油器



GKY26F
工具袋



GKY20D
腳踏板

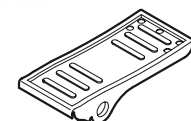


KY21-1/MY21
鉤子/鍊條




針*4




ZY04
零件圖



ZY02
使用說明書



PARTS LIST FOR ZY (1) GROUP

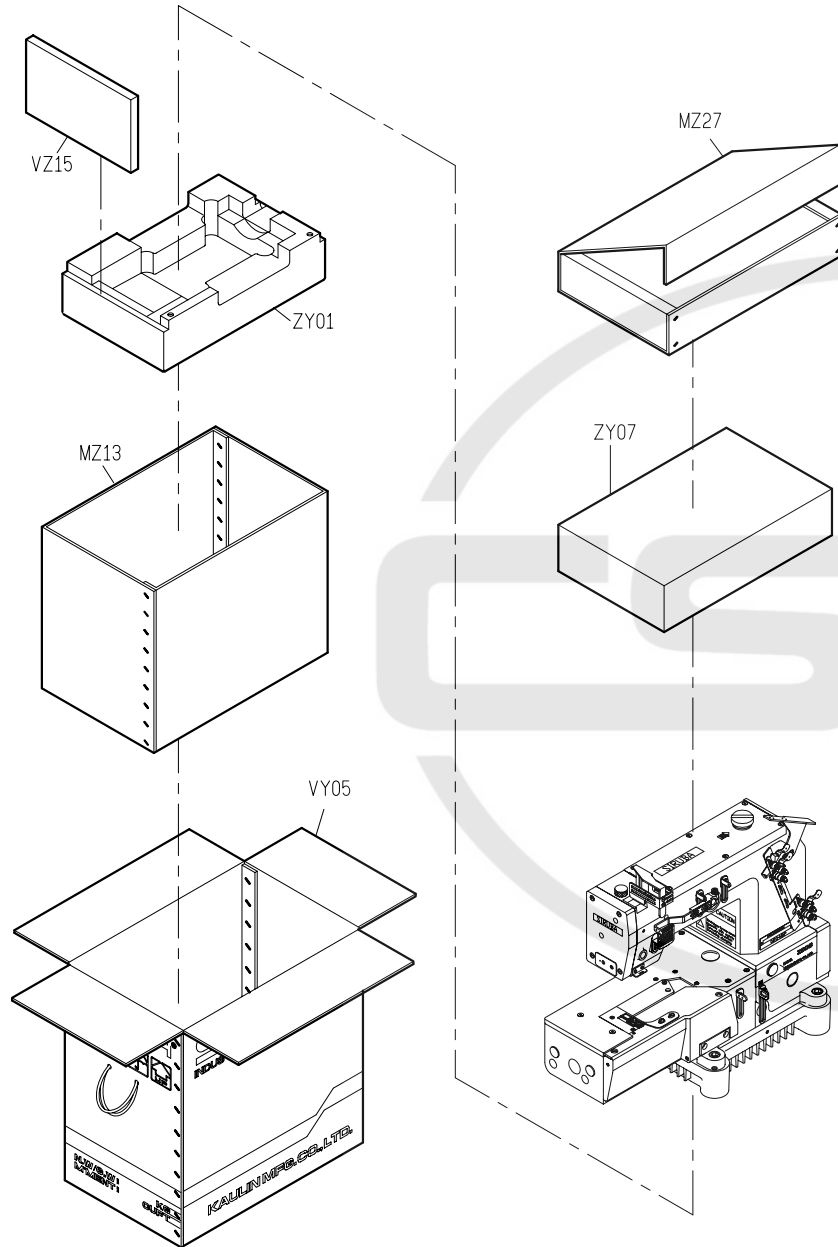



Z008

高林股份有限公司 KAULIN MFG. CO., LTD.



The specification and/or appearances of the equipment described in this parts list are subject to change because of modification without previous notice.

ZY04, NOV. 2006